

Date: Monday, 03/11/2008 10:40:53 AM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 350 SKIDTUBE ASSEMBLY LH
Job Number	: 43143		
Estimate Number	: 10266		
P.O. Number	:	Part Number	: D350636013
This Issue	: 03/11/2008	S.O. No.	:
Prsht Rev.	: NC	Drawing Number	: D2750 REV F
First Issue	: / /	Project Number	: N/A
Previous Run	: 42912	Drawing Revision	: F
	Type : SKIDTUBES	Material	:
Written By	:	Due Date	: 15/11/2008
Checked & Approved By	: <u>JLD 08.11.03</u>	Qty:	1 Um: Each
Comment	: Est Rev:H 02.09.25 Rearranged procedure steps KJ est rev I 06.03.30 Per rev. D dwg EC Est Rev:J 07-07-28 Added SS Wearplates(Rev E) JLM Verified By:EC Est Rev:K 08-09-23 revF as per dwg DD verified by:ec		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Handwritten: JLD 08.11.25

**Comment:** DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-013 CHG 004

Handwritten: 08/12/03

2.0	D26003BENT	Extrusion Bent
-----	------------	----------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
1 D2600-3-Bent	Extrusion (Bent)	42940

Handwritten: RT 08 10 06

3.0	D2744	Cap
-----	-------	-----

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Handwritten: 239242 BE 08/11/06

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 6 (D2750-3 details).Drill using drill Jig DT8150 & DT8864 .

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8864 and cut

Handwritten: RT 08 11-06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

as per dwg D2750.

4-Drill pilot holes for the blade fitting bolt holes using DT8983. Open to 0.500".

5- locate DT8330 off of blade fitting bolt holes and drill pilot holes for blade fitting.

6-Open up holes for SECTION AW-AW to 0.375" (2 holes per side) and blade fitting location holes to 0.500" (total of 4 holes per side) as per dwg D2750. Open holes for ground handling and detail T to 0.500" (8 holes per side)

7-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.297"

8-Open up holes of Detail S to 0.297" (total of 2 holes per side)

9-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod *m109213 BE 08/11/06*

12-Grind welds flush as per Dwg D2750

13- scribe batch #.

*ET
08-11-06*

> JB 8-11-7

5.0 QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

08-11-07

6.0 QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08-11-07

7.0 HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1
Chemical Conversion Coat as per QSI 005 4.1

SL 8-11-8

8.0 QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-11-08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

9.0	D2739	350 I Beam
-----	-------	------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

Batch: B-43163

AWM 8-11-10

(1X)

10.0	D34901	Cross Bolt Spacer
------	--------	-------------------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch: B43013

BE

08-11-12

11.0	D34905	Cross Bolt Spacer
------	--------	-------------------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch: B43015

BE

08-11-12

12.0	D2743	Crossbolt Spacer
------	-------	------------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch: B41113

(4PC)

B42777

(4PC)

BE 08-11-12

13.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
------	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Open up holes section AW-AW 0.500" (4 per side) as per dwg D2750

2- Open holes section AV-AV 0.3125" (4 per side)

3-Open up holes of Detail T and ground handling to 0.625" (total of 8 holes per side) as per dwg D2750.

4-Chamfer holes of section AW-AW, AV-AV, T and ground handling. (welding instructions on sheet 10)

5-Deburr and blow out all chips from inside of tube. Prepare tube for welding, remove alodine as required.

6-Bond web D2739 in place as per QSI 015

A/R Sikaflex-291

batch: M109449

exp. date: 8-11-30

AWM 8-11-10

SL8-11-9

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #: Machine Or Operation: Description :

7- Weld spacers D3490-1, D3490-5 and D2743 as per dwg D2750 & QSI004

(welding instructions on sheet 10)

A/R

Aluminum Rod

batch:

M109813

BE 08/11/12

8-Grind welds flush as per Dwg D2750

9-Spot face ground handling holes (total of 4 places per side) as per dwg D2750

10-Deburr holes

-Aw m 8-11-13

14.0

QC10

VISUAL INSPECTION OF GROUND WELDS



08-11-13 (1)



Comment: VISUAL INSPECTION OF GROUND WELDS

15.0

QC5

INSPECT WORK TO CURRENT STEP



08-11-13 (1)



Comment: INSPECT WORK TO CURRENT STEP

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FL 08/11/13 (1)

17.0

POWDER COATING

POWDER COATING



M109152



(1X)

Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

M-L 08/11/13

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



MS



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

08-11-26 (X)

19.0

ALS41032225

Insert



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)

Insert

Batch:

M100621

MS

08-11-26

(X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #: Machine Or Operation: Description :

20.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1
1-Install inserts as per dwg D2750

JL - 08-11-26 XP

21.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)
Bushing
Batch: 1342778 JW

22.0

D37911

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Wearplate
Batch: 1342982 JW

23.0

D37931

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Wearshoe
Batch: 1342479 JW

24.0

D37933

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Wearshoe
Batch: 1342927 JW

25.0

D37941

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Gasket
Batch: 1343147 JW

26.0

D37943

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Gasket
Batch: 1343116 JW

08-11-26

XP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D353525	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B42926 JW

28.0	D353625	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B412980 JW

29.0	D35371	Wearpad
------	--------	---------



Comment: Qty.: 3.0000 Each(s)/Unit Total : 3.0000 Each(s)

WEARPAD

Batch: (1x) B42351 / (2x) B413171 JW

30.0	D36311	Washer
------	--------	--------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

WASHER

Batch: B41141 JW

31.0	D3488041	Blade Fitting Assembly, LH
------	----------	----------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, LH

Batch: B41206 JW

32.0	NAS1611010	O-RING
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

O-RING

NAS1611-010 batch: (X8)

(or MS28775-010) batch: M109962 JW

33.0	D3492041	Plug Assembly
------	----------	---------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B42936 JW

08-11-26 QV

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

34.0	D3492045	Plug Assembly
------	----------	---------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 13 42478

JS

35.0	AN3C5A	Bolt
------	--------	------



Comment: Qty.: 34.0000 Each(s)/Unit Total : 34.0000 Each(s)

Bolt

Batch: M110002

JS

36.0	AN3C6A	BOLT
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M1108880

JS

37.0	AN6C44A	BOLT
------	---------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M1110105

JS

*

38.0	AN8C35A	BOLT
------	---------	------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M1110105

JS

*

39.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

washer

Batch: M109798

JS

40.0	AN960C816L	WASHER
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WASHER

Batch: M1109632

JS

08.12.02

(11)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

41.0	MS210436	NUT
------	----------	-----



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

NUT

Batch: M1109751

JK

42.0	MS21083C8	NUT
------	-----------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

NUT

Batch: B43452

M1109749

JK

43.0	NAS1515H3L	WASHER
------	------------	--------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

WASHER

Batch: M1106516

JK

44.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

✓ 1-Inspect for Foreign Objects

✓ 2-Spray inside of tube with "LPS-3" batch: M109539

3-Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D2750
SIKA FLEX 241

✓ BATCH: M1109449

EXP DATE: 08/11

✓ 4-assemble o'ring as per dwg D3492 and apply o'ring lube

A/R 55-o'ring lube batch: M1101223

✓ 5-Coat all exposed fasteners with "LPS Procyon" batch: M1104251

JK

08-12-02

45.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

08/12/02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #: Machine Or Operation: Description :

46.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
Pick Packing Kit

47.0

D2741

Blade, 350 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Blade
Batch: B42222

50

48.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Washer
Batch: M109632

50

49.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Nut
Batch: M109810

50

50.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Bolt
Batch: M109772

50

51.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
WASHER
Batch: M108964

50

52.0

D34931

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
WASHER
Batch: M108229

8/12/13

(1x)

50

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 03/11/2008 10:40:53 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 43143

Part Number: D350636013

Job Number:



Seq. #:

Machine Or Operation:

Description :

53.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

08/12/03 (40)

54.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-013

Rev G

Lost checked.

08/12/03 (40)

55.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/12/04 (40)

Job Completion



MF 08-12-03

B43143

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER


GENERAL NOTES:

- 1) MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- 2) FINISH:
ACID ETCH, ALONDE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- 8) WELD PER DART QSI 004
- 9) INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES (Ø0.297) FOR WEARSHOE INSERTS
- 10) FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- 11) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS.
COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
POWDER COATING WITH MEK DEGREASER.
- 12) SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- 13) SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL


RELEASED
6-27-2014

F	INCORPORATE DSI 9413; QTY (3) D3537-1 WAS QTY (9) (ZN C8-1); D3791-1/3 REPLACES D3535-13/-35 (ZN C8-1); D3794-1/3 REPLACES D3536-13/-35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWD/AFT SADDLE REMOVED (8 PL). WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS. CHANGE INSERTS. ADD D3631-1; REMOVE QTY (38) NAS1515H3L. REMOVE QTY (10) NAS1515H3L. REMOVE D2741. QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DED 9133/8157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	98.11.18
B	CHANGE MS24694-S293 TO AN8-16A	CP	98.09.01
A	NEW ISSUE	DS	98.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
DE APPR.			
DATE	08.07.16		
DART AEROSPACE USA, INC. PORT HADLOCK, WA			
DRAWING NO. D2750		REV. F	
TITLE 350 SKIDTUBE ASSEMBLY		SHEET 1 OF 11	
		SCALE NTS	
COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

NO
3475
FOR
RETURN TO
ENGINEERING
CONTROLLED COPY
TO AMENDMENT
WITHOUT NOTICE

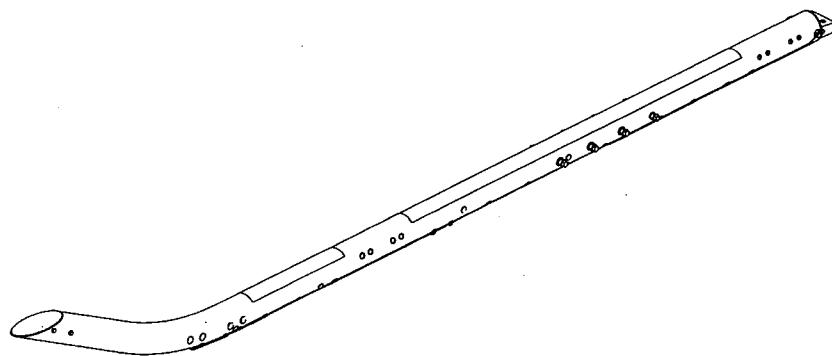

D2750-041 350 SKIDTUBE ASSEMBLY, LH

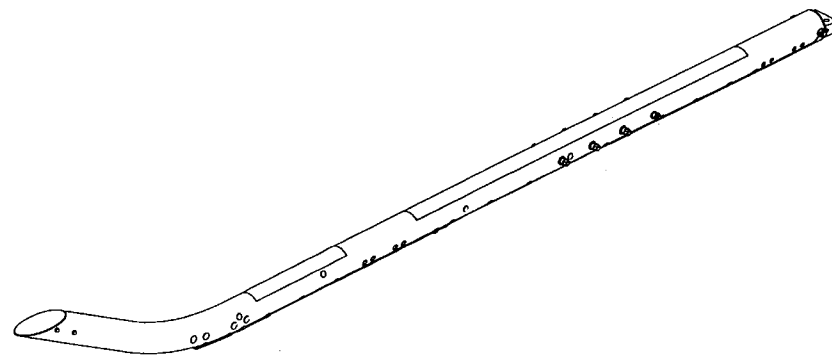


D2750-042 350 SKIDTUBE ASSEMBLY, RH

RELEASED
18 APR 1977

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO. 4343
WORK ORDER

DESIGN	PC	DART AEROSPACE USA, INC.	
DRAWN	AM	PORT HADLOCK, WA	
CHECKED	AM	DRAWING NO. D2750	REV. F
MFG. APPR.	AM	SHEET 2 OF 11	
APPROVED	AM	TITLE	SCALE
DE APPR.	AM	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

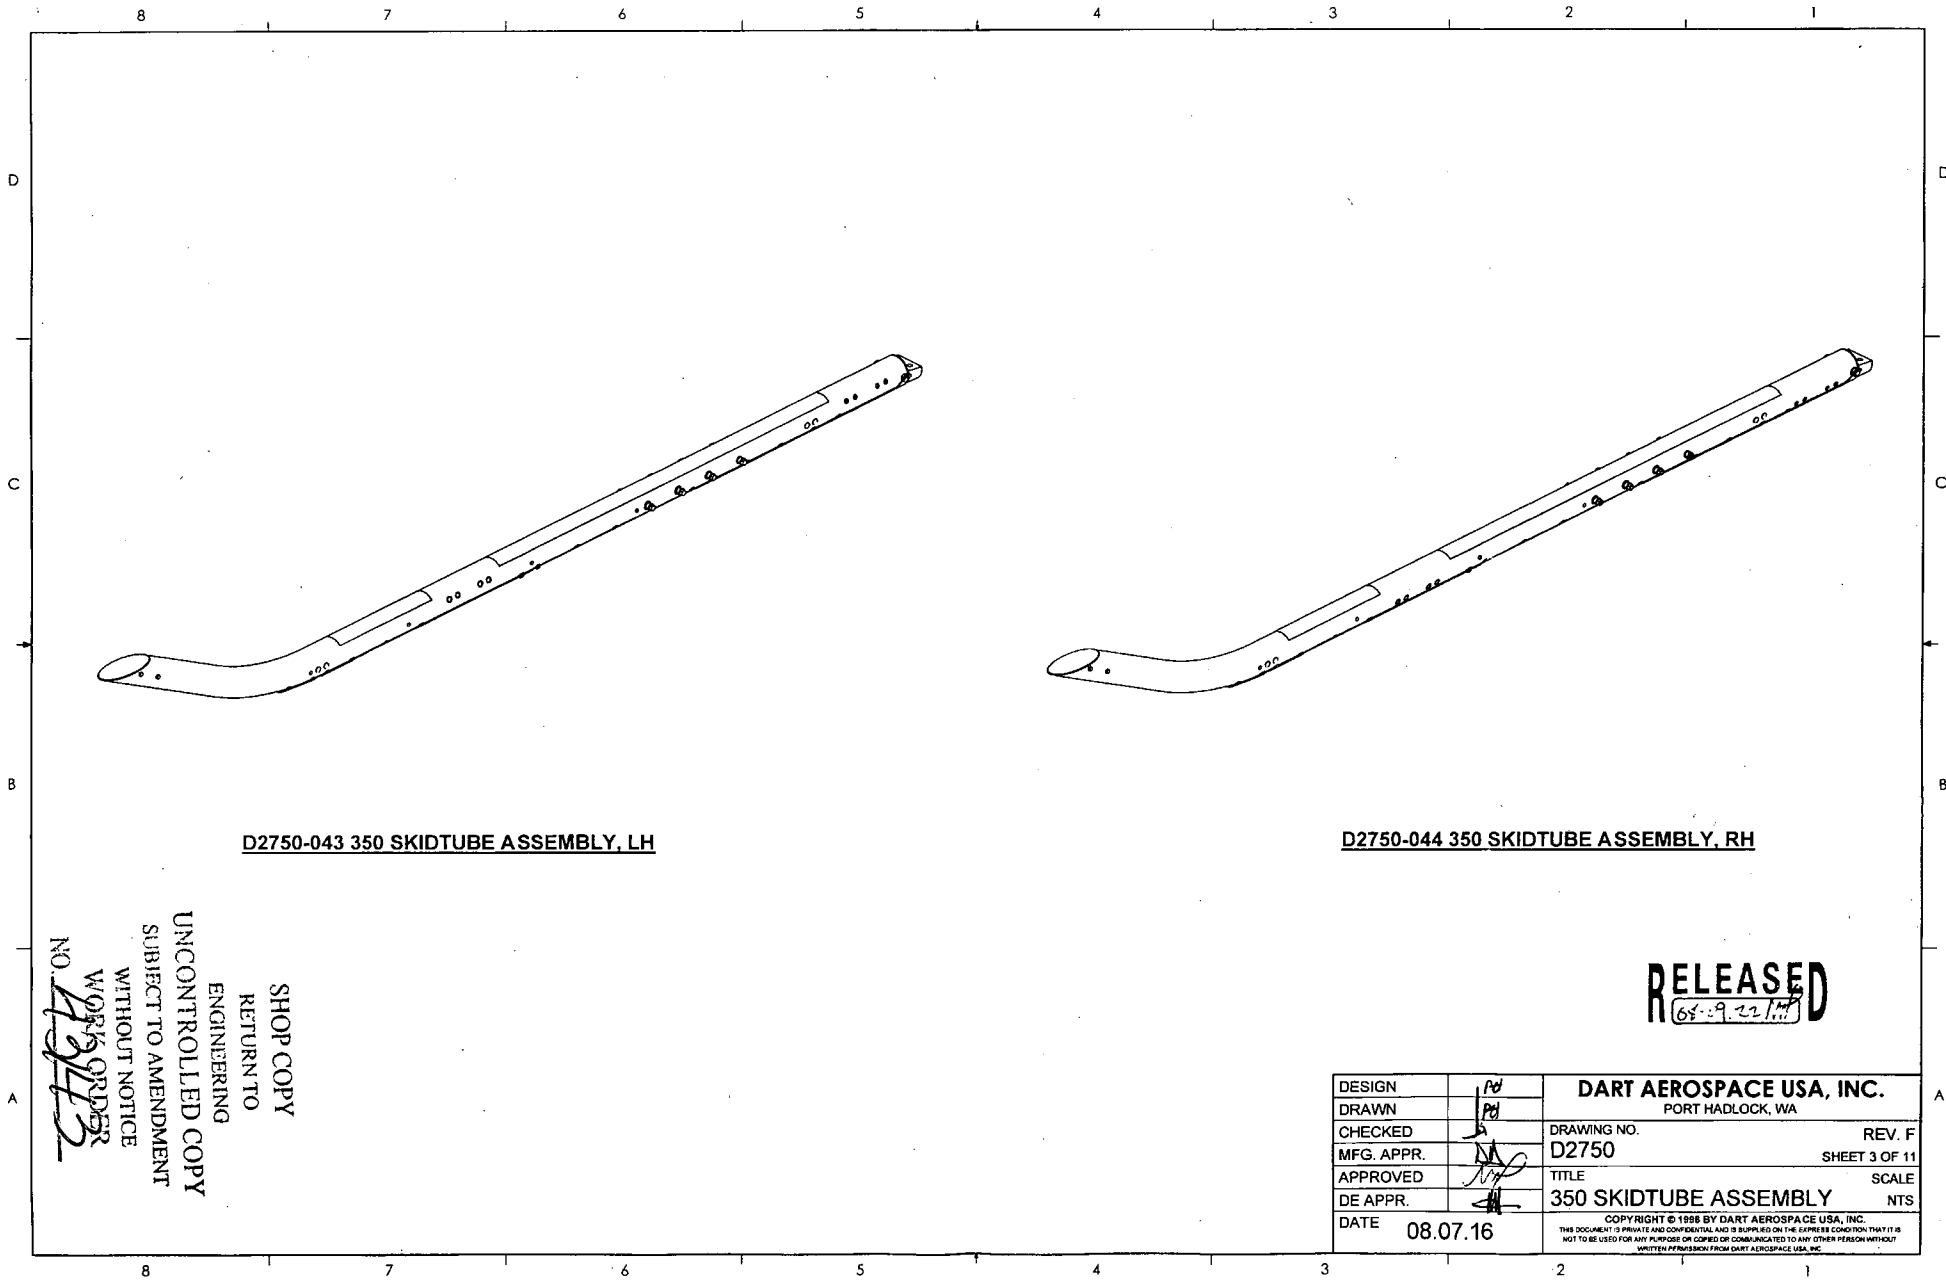


D2750-043 350 SKIDTUBE ASSEMBLY, LH

D2750-044 350 SKIDTUBE ASSEMBLY, RH


RELEASED
68-09-22/11

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 43943

DESIGN		DART AEROSPACE USA, INC.	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.		TITLE	SHEET 3 OF 11
APPROVED		350 SKIDTUBE ASSEMBLY	SCALE NTS
DE APPR.		<small>COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.</small> <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	
DATE	08.07.16		

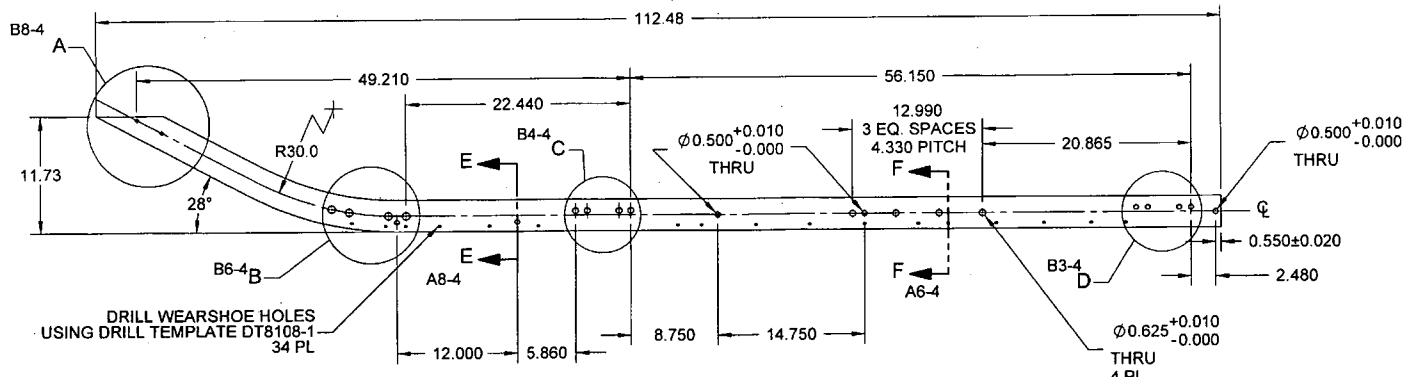


D2750-1 LH SKIDTUBE

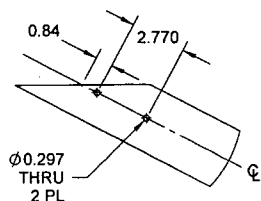


DETAIL A
SCALE 2X

D7-4

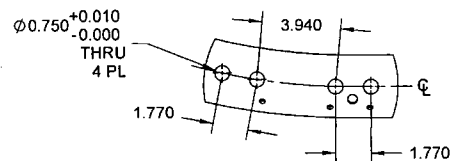


DETAIL B
SCALE 2X

D7-4

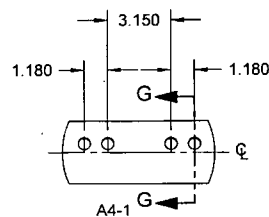


DETAIL C
SCALE 2X

D5-4

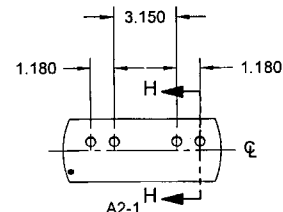


DETAIL D
SCALE 2X

D3-4

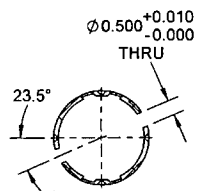


SECTION E-E
SCALE 3X, 2 PL

D6-4

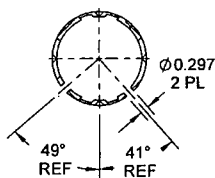


SECTION F-F
SCALE 3X, 17 PL

D4-4

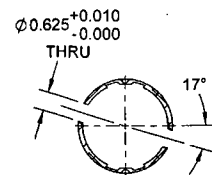

SECTION G-G
SCALE 3X, 4 PL

B4-4

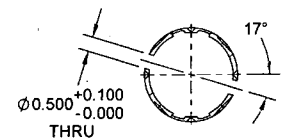


SECTION H-H
SCALE 3X, 4 PL

B2-4


RELEASED

DESIGN	IPH	DART AEROSPACE USA, INC.	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 4 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


NO. 43943
WORK CENTER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
CONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

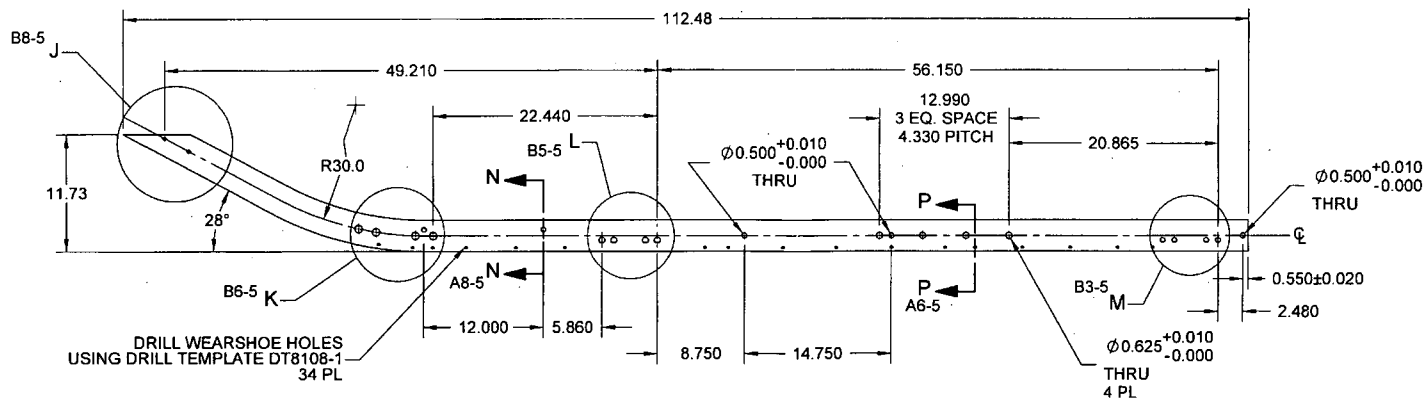


D2750-2 RH SKIDTUBE

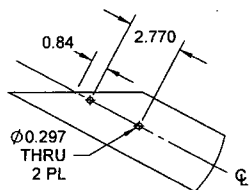


DETAIL J
SCALE 2X

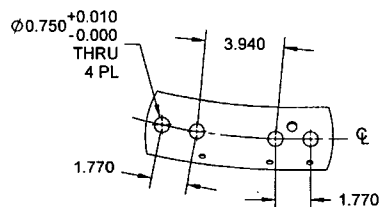


DETAIL K
SCALE 2X

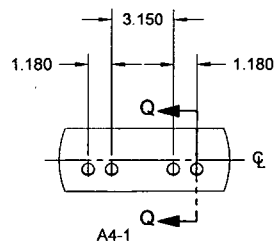


DETAIL L
SCALE 2X

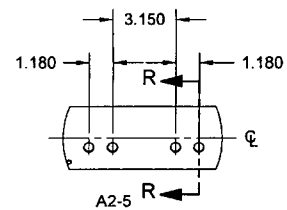


DETAIL M
SCALE 2X

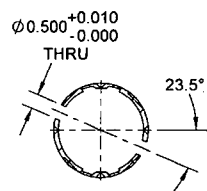


SECTION N-N
SCALE 3X, 2 PL

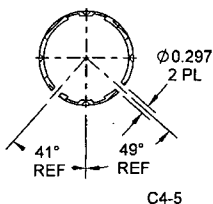

SECTION P-P
SCALE 3X, 17 PL

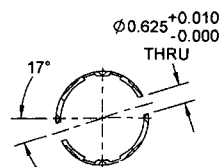

SECTION Q-Q
SCALE 3X, 4 PL

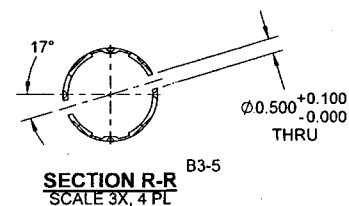

SECTION R-R
SCALE 3X, 4 PL


RELEASED

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.		TITLE	SHEET 5 OF 11
APPROVED		350 SKIDTUBE ASSEMBLY	SCALE
DE APPR.			NTS
DATE	08.07.16		


COPYRIGHT © 1996 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO. 443143
WORK IN PROGRESS
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
DART AEROSPACE USA, INC.


8 7 6 5 4 3 2 1

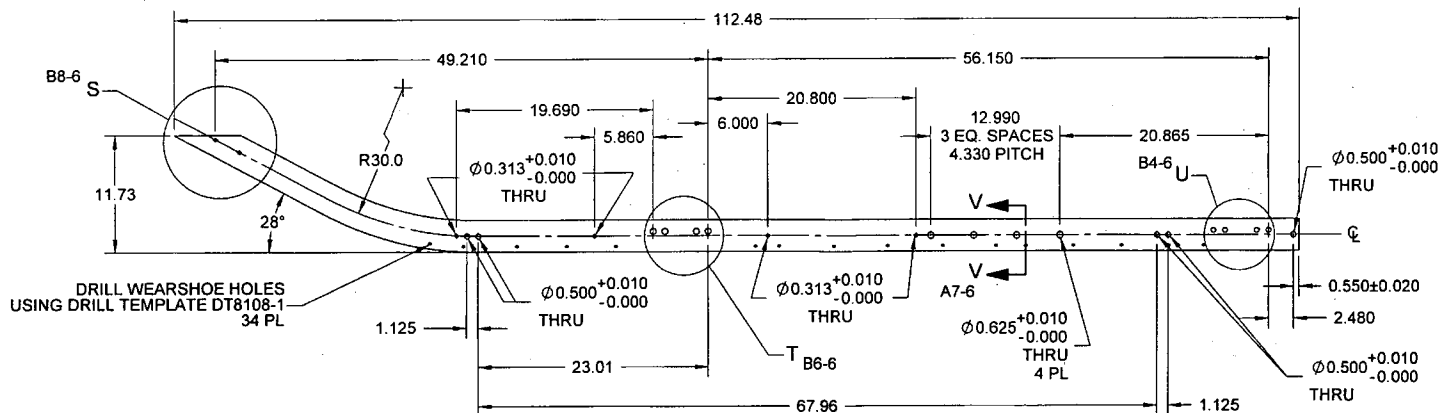


D2750-3 LH SKIDTUBE

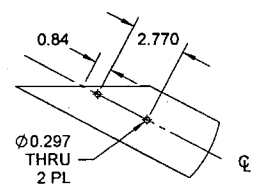


DETAIL S
SCALE 2X

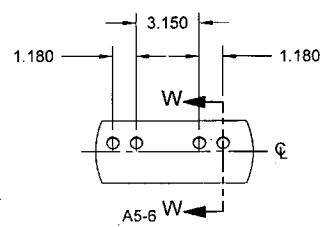


DETAIL T
SCALE 2X

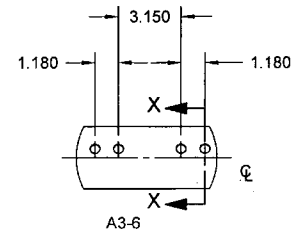


DETAIL U
SCALE 2X

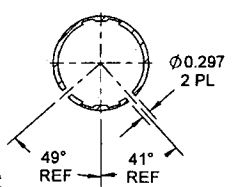

SECTION V-V
SCALE 3X, 17 PL

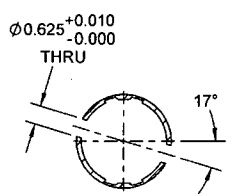

SECTION W-W
SCALE 3X, 4 PL

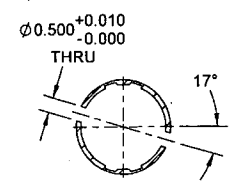


SECTION X-X
SCALE 3X, 4 PL

RELEASED


DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO. D2750	REV. F
MFG. APPR.		SHEET 6 OF 11	
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMED ON COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO. 428173
 WORK COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE


7 6 5 4 3 2 1

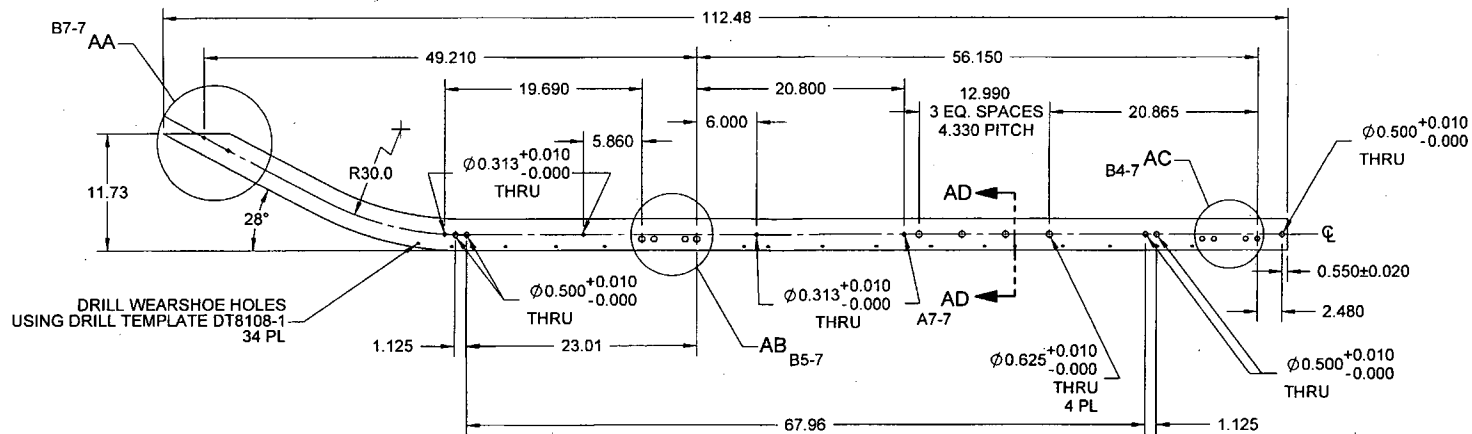


D2750-4 RH SKIDTUBE

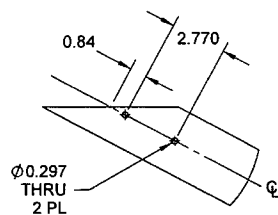


DETAIL AA
SCALE 2X

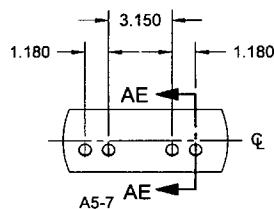


DETAIL AB
SCALE 2X

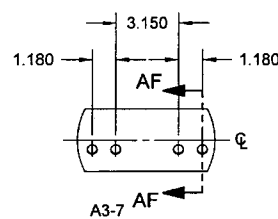


DETAIL AC
SCALE 2X

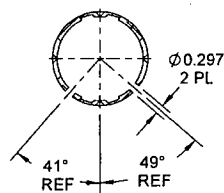

SECTION AD-AD
SCALE 3X, 17 PL

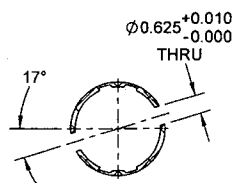

SECTION AE-AE
SCALE 3X, 4 PL

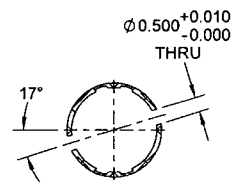


SECTION AF-AF
SCALE 3X, 4 PL






RELEASED
06-29-22

DESIGN	AK	DART AEROSPACE USA, INC.	
DRAWN	AK	PORT HADLOCK, WA	
CHECKED	AK	DRAWING NO.	REV. F
MFG. APPR.	AK	D2750	SHEET 7 OF 11
APPROVED	AK	TITLE	SCALE
DE APPR.	AK	350 SKIDTUBE ASSEMBLY	
DATE	08.07.16	NTS	
COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCE OR COMMUNICATIONS TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

NO. 43143
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOW COPY

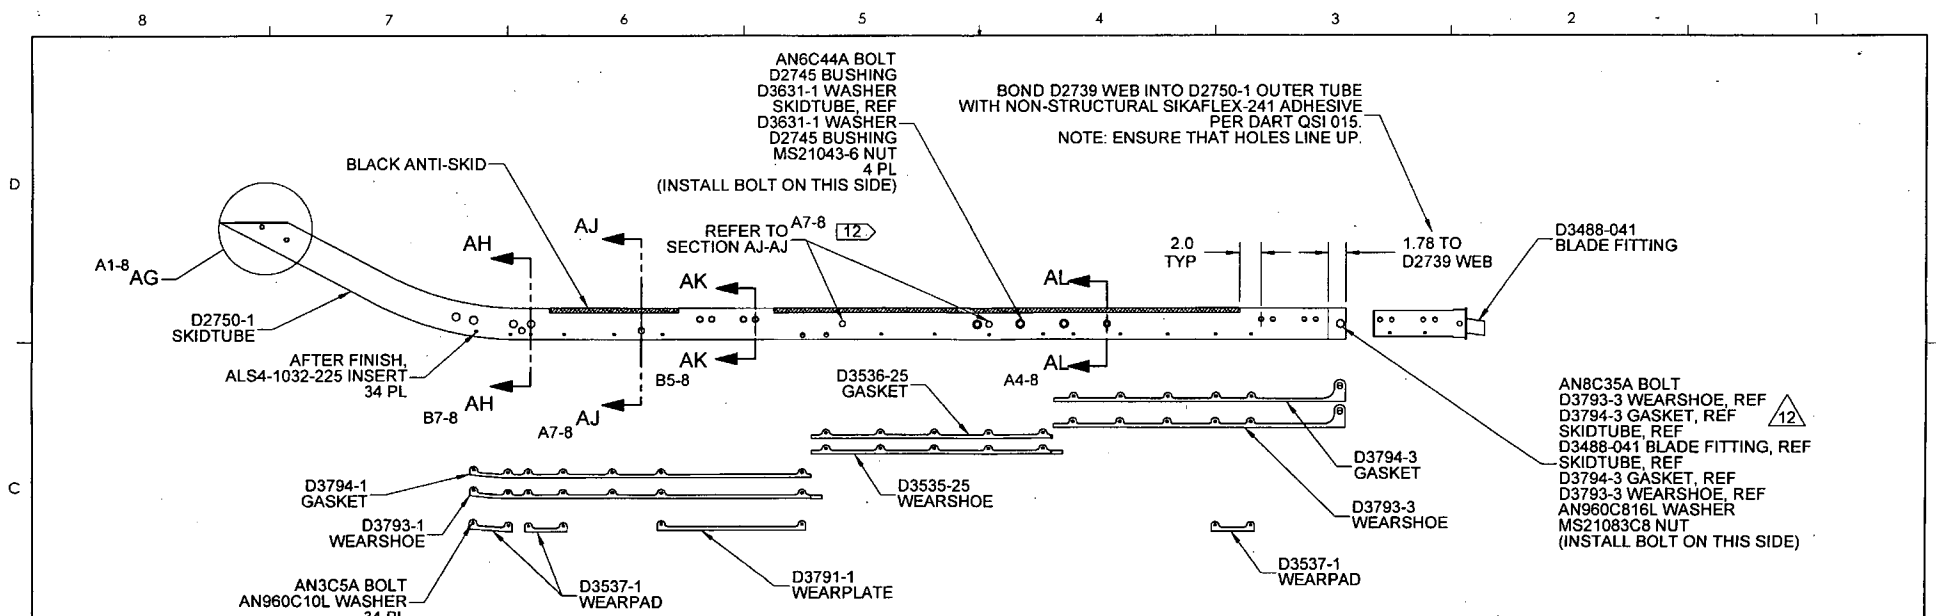


D2750-041 350 SKIDTUBE ASSEMBLY, LH

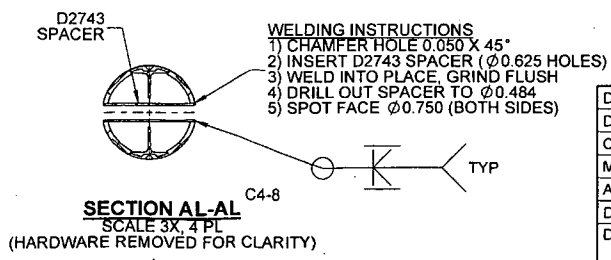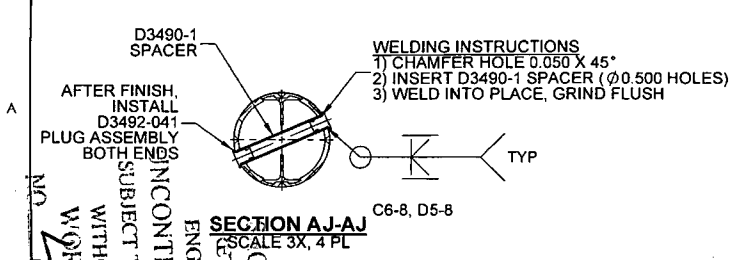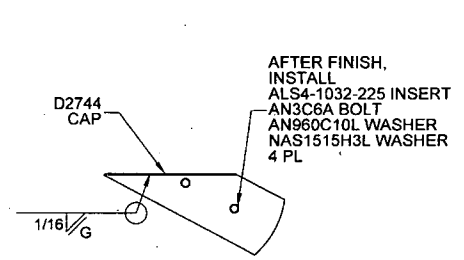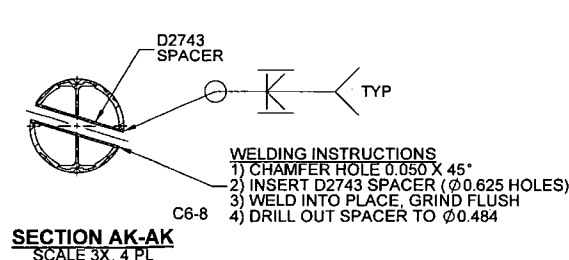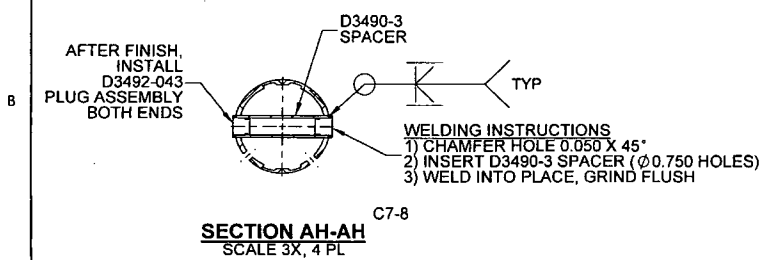

RELEASED
D8-8
DETAIL AG
SCALE 2X

DESIGN	PA	DART AEROSPACE USA, INC.	
DRAWN	PA	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 8 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO
WORK
4/2/92
UNCONTROLLED COPY
ENGINEERING
RETURN TO
CP COPY
WITHOUT NOTICE
SUBJECT TO AMENDMENT

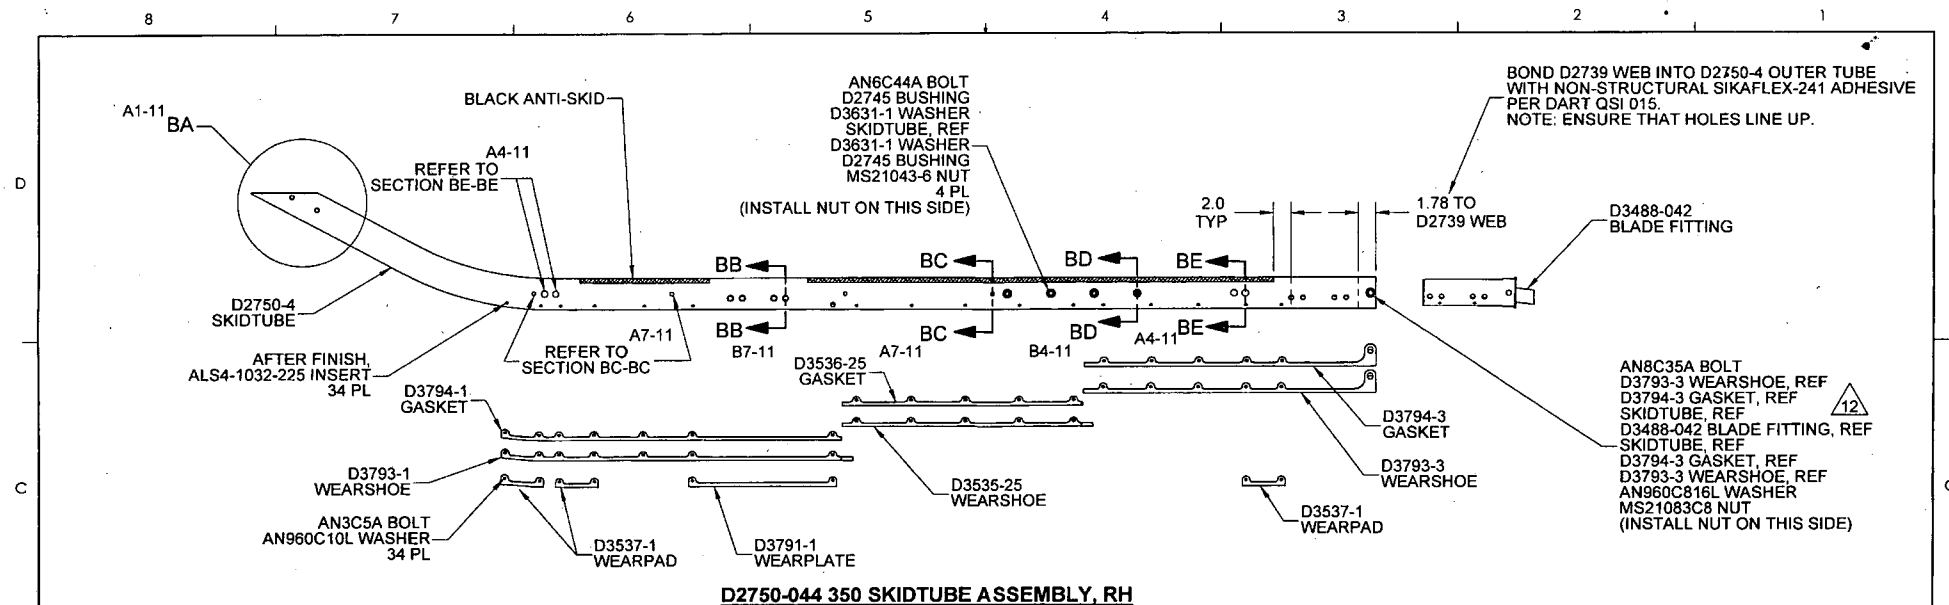

SECTION
SC
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 4348